


L.V.T.

# Divino

## Specifications:

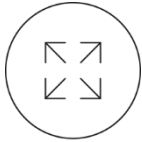

Dimensional stability




Slip resistant




Castor wheel resistant




Thermal resistance

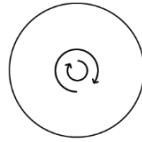

Long lasting

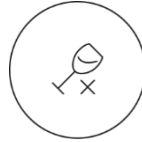

Stain resistant

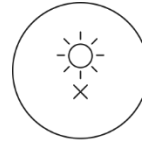

Light fastness

Level of use -	23 – 33 – 42
Total thickness -	2.50 mm
Wear layer -	0.55 mm
Wear layer PUR treatment -	Superguard®
Total weight -	4.059 g/m <sup>2</sup>
Planks -	19.6 x 132.0 cm (7.72" x 51.97")
Box planks -	14 pc/box, 3.62 m <sup>2</sup> /box (38.99 ft <sup>2</sup> /box)
Inflammability -	Bfl-S1
Critical Radiant Flux -	8.9kW/m <sup>2</sup>
Scratch resistance -	Type I
Squareness & straightness -	≤ 0.35 mm
Slip resistance -	DS
Slip restraint -	R10
Residual indentation -	≤ 0.10 mm
Furniture leg resistance -	No cracks, no damage
Electrical resistance -	≤ 10 <sup>9</sup> Ohm
Dimensional stability -	Norm: ≤ 0.25 %, Average result measured: ≤ 0.05 %
Heat insulation -	0.25 w/(m.K)
Thermal resistance R -	0.0100 m <sup>2</sup> K/W
Electrostatic performance -	< 2 kV
Acoustic insulation -	4 dB
Castor chair resistance -	No damage to wearlayer, no delamination
Stain resistance -	Very good
Light fastness -	≥ 6
Underfloor heating -	Suitable, max 27°C
Warranty (year) -	20 Residential / 10 Commercial

- RUBBER MIGRATION: This is a condition that can cause vinyl to discolour. Migration occurs when latex or rubber products such as shoes, rubber backed mats or rubber soled slippers come into contact with vinyl over a period of time. This is not a manufacturing fault and therefore is not covered under our warranties.
- Warranties are extended to the original purchaser of the product only and are not transferable.

Please contact us on 03 366 9839 to request any samples or other product details.

international  
flooring solutions

p 03 366 9839 e office@robertmalcolm.co.nz  
59 Halwyn Drive, PO Box 914, Christchurch 8140, New Zealand  
robertmalcolm.co.nz



robert malcolm