


L.V.T. Divino

Specifications:



Dimensional
stability

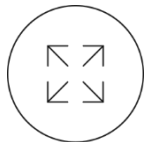


Slip
resistant




Castor wheel
resistant




Thermal
resistance

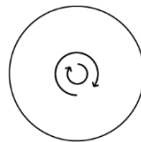

Long
lasting

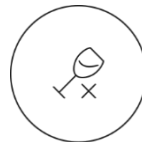

Stain
resistant

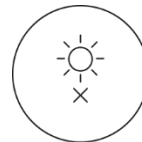

Light
fastness

Level of use ISO 10874 -	23 – 33 – 42
Total thickness -	2.50 mm
Wear layer -	0.55 mm
Wear layer PUR treatment -	Superguard®
Total weight -	4063 g/m ²
Planks -	19.6 x 132.0 cm
Box planks -	14 pc/box, 3.62 m ² /box
Inflammability EN 13501-1 -	Bfl-S1
Critical Radiant Flux EN ISO 9239-1 -	6.4 kW/m ²
Scratch resistance EN 16094 -	Type T
Squareness & straightness -	≤ 0.35 mm
Slip resistance -	DS
Slip restraint EN 16165 annex B -	R9
Residual indentation EN ISO 24343-1 -	≤ 0.10 mm
Furniture leg resistance -	No cracks, no damage
Electrical resistance -	≤ 10 ⁹ Ohm
Dimensional stability -	Norm: ≤ 0.25 %, Average result measured: ≤ 0.05 %
Heat insulation -	0.25 w/(m.K)
Thermal resistance R -	0.0100 m ² K/W
Electrostatic performance -	< 2 kV
Acoustic insulation -	3 dB
Castor chair resistance -	No damage to wearlayer, no delamination
Formaldehyde group EN 717-1 -	E1
Stain resistance -	Very good
Light fastness -	≥ 6
Underfloor heating -	Suitable, max 27°C
Wear Warranty (year) -	25 Residential / 10 Commercial

- RUBBER MIGRATION: This is a condition that can cause vinyl to discolour. Migration occurs when latex or rubber products such as shoes, rubber backed mats or rubber soled slippers come into contact with vinyl over a period of time. This is not a manufacturing fault and therefore is not covered under our warranties.
- Warranties are extended to the original purchaser of the product only and are not transferable.

Please contact us on 03 366 9839 to request any samples or other product details.

international
flooring solutions

p 03 366 9839 e office@robertmalcolm.co.nz
10 Establishment Drive, Christchurch 8042, New Zealand
robertmalcolm.co.nz


robert malcolm